 
 

 


Arch inner surface, north east side

Arch inner surface, south west side

CONDITION	 Friable/spalling surface	 Friable/eroded surface with loss of section	 Completed frost-damaged/lost section	F - Fracture	MR - Mortar repair	EB - Embedded iron
PROPOSED REMEDY	Consolidation with sheltercoat generally (whole block); mortar repair to remove water shedding	Mortar repair to non-weathering surfaces; stone indent to weathering surfaces	Stone indent or stone replacement	Pin/micro-pin	No work if sound Repeat if faulty	No work if stable Drill out and mortar repair if corroding

A 10.07.2022 Elevation replaced with scanned condition survey & notes



Conservation
Anti-slavery Arch, Paganhill Stroud
for Stroud District Council

Arch inner surfaces Condition

David Newton Associates
The Mercers House, The Street, Leonard Stanley, Gloucestershire GL10 3NR
Telephone: 01453 792172 E-mail: davidatdna@gmail.com

Scale: 1:25. Original drawing A3

Date: July 2022

295-SU05 RevA